

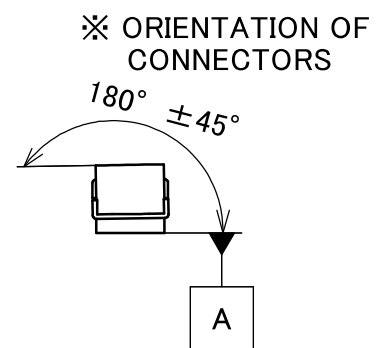


PART NO.	L
8-25-0913	200.00±1.0 mm


PLEASE CONTACT I-PEX FOR REQUESTS OTHER THAN THIS SPECIFICATIONS.
PLEASE NOTE IF SPECIFICATIONS CHANGE, PART NO. WILL ALSO CHANGE.

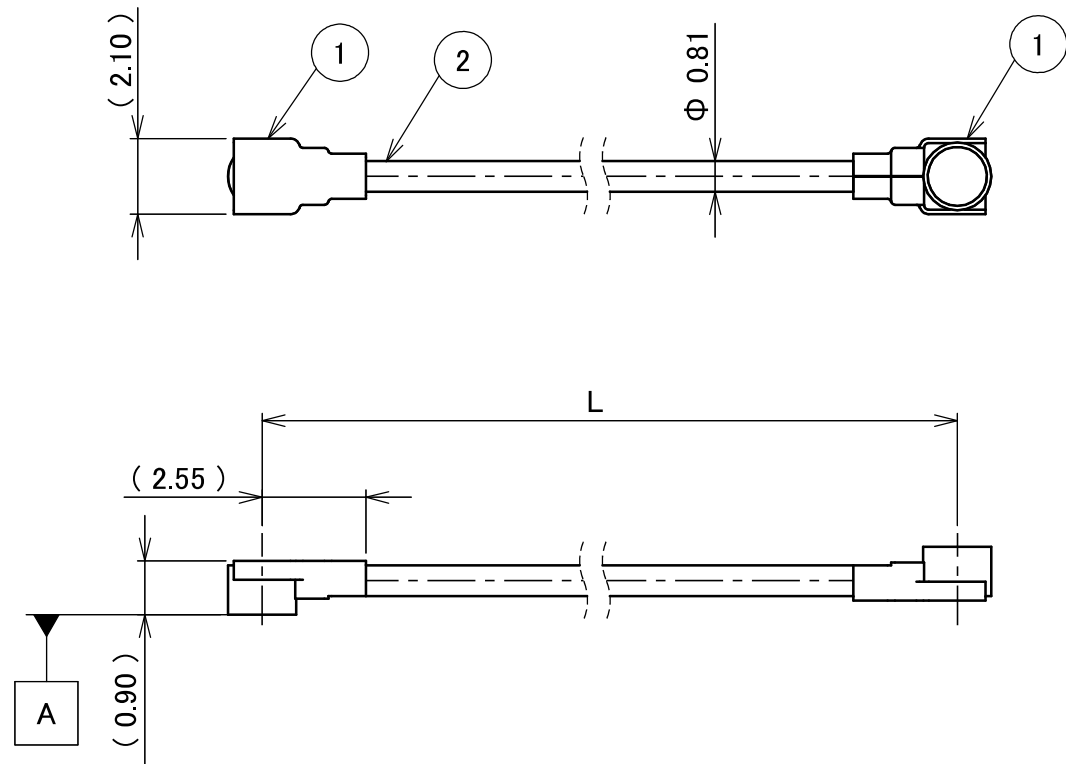


NOTES
1. SUGGESTIONS FOR MATING & UNMATING OPERATION.
1-1. MATING
MATE THE CONNECTOR VERTICALLY,
ALIGNING THE MATING AXIS ON PLUG AND RECEPTACLE.
DO NOT SLANT MATE.
1-2. UNMATING
1-2-1.
UNMATING BY PULLING TOOL.
[P/N 90435-001 (MHF 4),]
USE THE PULLING TOOL AS THE FOLLOWING, AND
PULL PLUG TO VERTICAL DIRECTION AS DIRECTLY AS POSSIBLE.

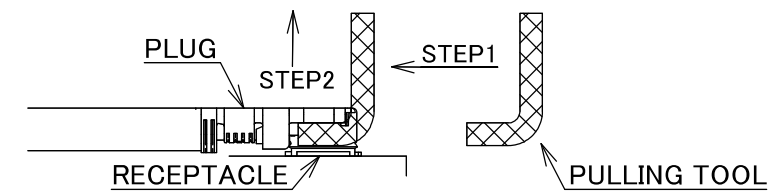

1-2-2.
UNMATING DIRECTLY BY HAND.
HOLD THE CATCHING AREA ON PLUG AND PULL THE PLUG
VERTICALLY.

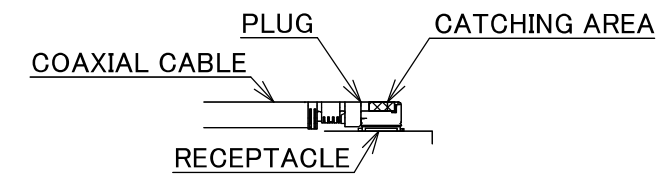

2. PACKING : PLASTIC BAG
3. PERMISSIBLE LOAD ON THE CABLE AFTER MATING

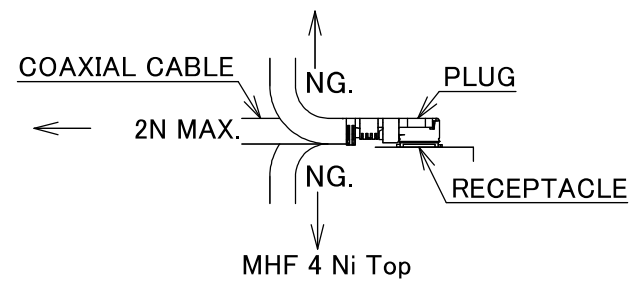

4. CABLE CRIMP STRENGTH : 5N MIN.

2	CABLE	1	AWG#36 $\Phi 0.81$, BRAIDED SHIELD , BLACK
1	CONNECTOR-1, 2	2	MHF 4 Ni Top
NO.	DESCRIPTION	QTY	REMARK

					ANGLE	$\pm 2^\circ$	6 OVER 30 MAX.	± 0.3		SERIES No.	H-250071B	CUSTOMER COPY			
					6 MAX.	± 0.2	30 OVER 120 MAX.	± 0.5							
					GENERAL TOLERANCE.				TITLE MHF [®] 4-4 CABLE081-2		SCALE	I-PEX			
					DWG.	DATE					X:1				
					Y.Nishimura 2025/12/10						UNIT				
0	ZH00223	Y.Ni	2025/12/10	-	CHK.	T.Takuno						mm			
REV.	ECN	BY	DATE	APP.	APP.					DWG. No.	8-25-0913		SIZE	SHEET	REV.
REVISION RECORD					K.Yufu						A3		1/1		0



Halogen Free



RoHS Compliant

Confidential C

I-PEX Inc.

QKE-DFFDE06-02 REV.12