

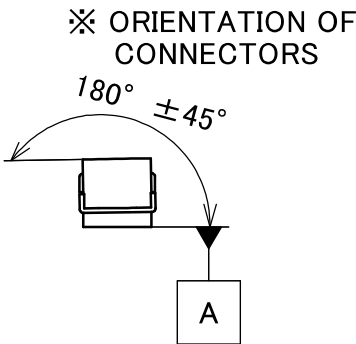
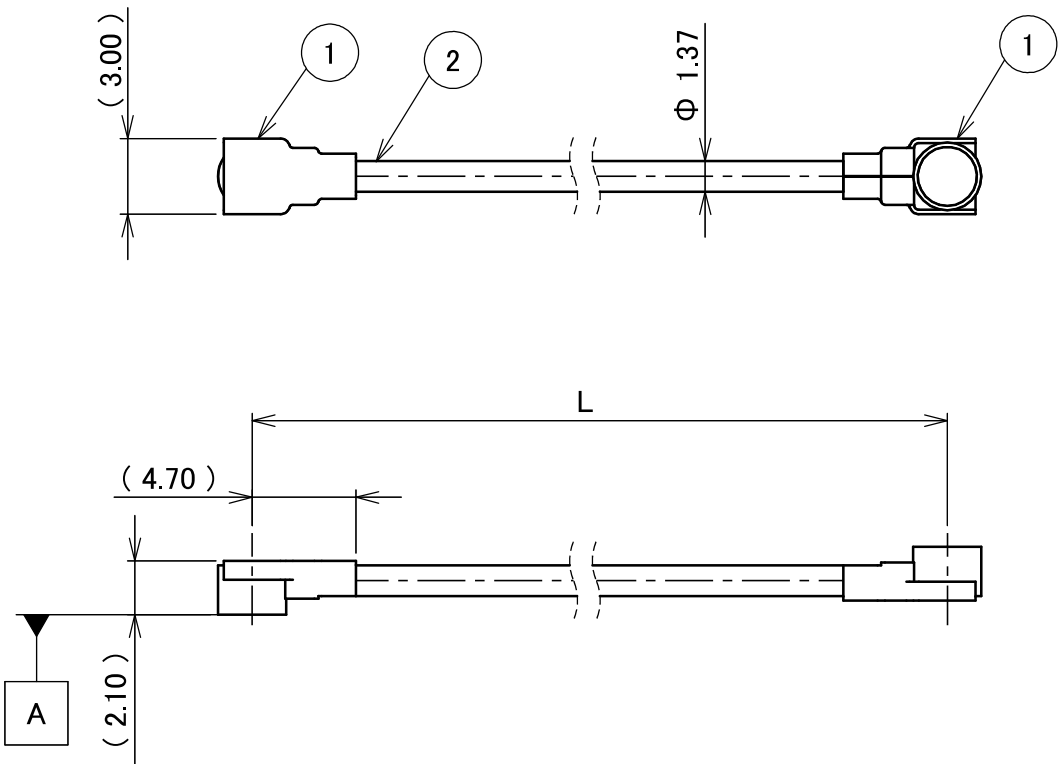
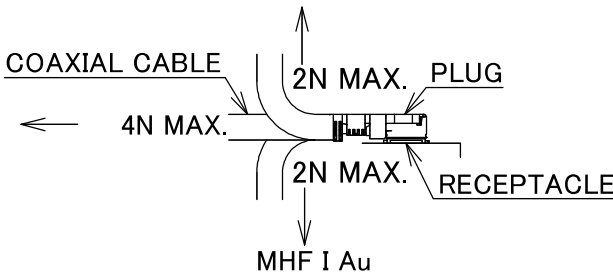


PART NO.	L
8-25-0845	100.00±1.0 mm

PLEASE CONTACT I-PEX FOR REQUESTS OTHER THAN THIS SPECIFICATIONS.
PLEASE NOTE IF SPECIFICATIONS CHANGE, PART NO. WILL ALSO CHANGE.

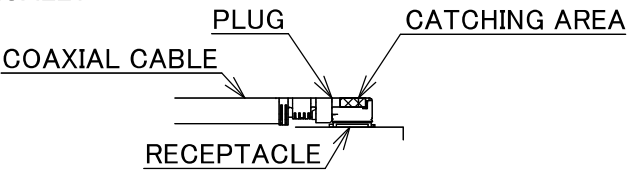

- NOTES
- SUGGESTIONS FOR MATING & UNMATING OPERATION.
 - MATING
MATE THE CONNECTOR VERTICALLY,
ALIGNING THE MATING AXIS ON PLUG AND RECEPTACLE.
DO NOT SLANT MATE.
 - UNMATING
 - UNMATING BY PULLING TOOL.
[P/N 90192-001 (MHF I),]
USE THE PULLING TOOL AS THE FOLLOWING, AND
PULL PLUG TO VERTICAL DIRECTION AS DIRECTLY AS POSSIBLE.
 - UNMATING DIRECTLY BY HAND.
HOLD THE CATCHING AREA ON PLUG AND PULL THE PLUG
VERTICALLY.
 - PACKING : PLASTIC BAG
 - PERMISSIBLE LOAD ON THE CABLE AFTER MATING
 - CABLE CRIMP STRENGTH : 15N MIN.

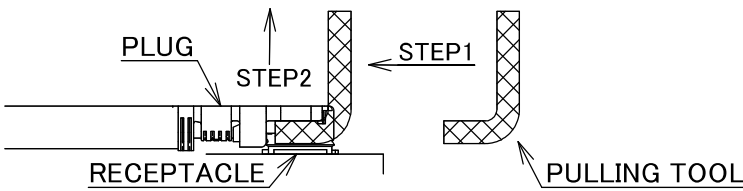

2	CABLE	1	AWG#30 $\Phi 1.37$, BRAIDED SHIELD , BLACK
1	CONNECTOR-1, 2	2	MHF I Au
NO.	DESCRIPTION	QTY	REMARK

					ANGLE	±2°	6 OVER 30 MAX.	±0.3		SERIES No.	CUSTOMER COPY		
					6 MAX.	±0.2	30 OVER 120 MAX.	±0.5		H-250060B			
					GENERAL TOLERANCE.				TITLE MHF® I-I CABLE137-2		SCALE	I-PEX	
				DWG.	DATE			UNIT					
				Y.Nishimura			2025/12/04						
				CHK.	T.Takuno								
0	ZH00204	Y.Ni	2025/12/04	-							mm		
REV.	ECN	BY	DATE	APP.	APP.				DWG. No.		SIZE	SHEET	REV.
REVISION RECORD					K.Yufu				8-25-0845		A3	1/1	0